

# We are IntechOpen, the world's leading publisher of Open Access books Built by scientists, for scientists

6,900

Open access books available

185,000

International authors and editors

200M

Downloads

Our authors are among the

154

Countries delivered to

TOP 1%

most cited scientists

12.2%

Contributors from top 500 universities



WEB OF SCIENCE™

Selection of our books indexed in the Book Citation Index  
in Web of Science™ Core Collection (BKCI)

Interested in publishing with us?  
Contact [book.department@intechopen.com](mailto:book.department@intechopen.com)

Numbers displayed above are based on latest data collected.  
For more information visit [www.intechopen.com](http://www.intechopen.com)



# Influence of Chemical Properties of Soil on the Corrosion Morphology of Carbon Steel Pipes

*Muhammad Wasim and Shahrukh Shoaib*

## Abstract


Corrosive soils are responsible for the deterioration of buried underground utilities such as buried steel pipes. Frequent pipe failures are reported due to corrosive soil globally. Although soil's corrosion phenomenon has been understood and identified long time ago, pipe failures due to corrosive soil are uncontrollable and unavoidable despite the use of protective coatings and techniques such as cathodic protection. Therefore, it is essential to review the causes of soil's corrosivity for the protection of steel pipes. This chapter demonstrates the influence of varying moisture and chloride contents of soils on the corrosion of coated and uncoated steel pipes. Carbon steel specimens (coated and uncoated) were buried in soils of 20, 40, 60, and 80 wt.% moisture content, respectively, while the chloride concentration introduced in soil was 0, 5, and 10 wt.%, respectively. Through the analysis of experiments, it is revealed that the corrosion rate of pipes buried in soil increases with increase in moisture content up to critical moisture and chloride values. The influence of soil's moisture and chloride on the corrosion products formed on steel pipes was investigated and comprehensively explained in this chapter. Authors believe that the knowledge presented in this chapter can be applied to other structures or utilities buried in corrosive soils.

**Keywords:** soil, moisture content, chloride, steel pipes and corrosion products

## 1. Introduction

The influence of soil's chemical properties is reported as the root cause of failures of buried pipes [1–7]. The chemical constituents of soil react with the surface of unprotected buried pipes, which in turn results in the corrosion of pipes. However, there is still no complete preventive solution to the corrosion caused by the chemical constituents of soil even in the presence of advanced corrosion protection techniques.

As per above referred studies, soil's constituents cause corrosion of buried pipes; these include moisture contents, pH, temperature, soil resistivity, soil type, soil particle size, permeability, differential aeration, and sulphate-reducing bacteria (see references above). Researchers have adopted various approaches based on field testing (all above references) and experiments [8–10] to investigate these factors. Soil has been reported as the main stimulants causing failure of buried metallic pipes as shown in **Figure 1** [3].

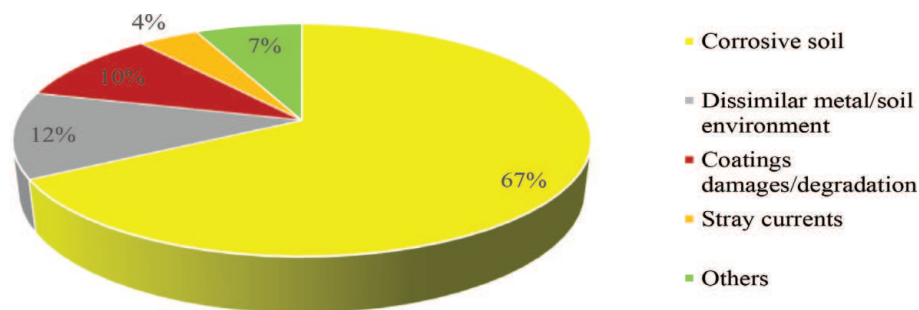

**Figure 1.** Worldwide causes of corrosion of metallic buried pipes (redrawn, originally by [3]).


Among the various factors, the acidity (pH) and moisture contents of soil are stated as the most important key factors influencing corrosion of buried pipes as per the latest comprehensive reviews [5–7]. The influence of soil chemical properties such as pH on the buried pipes has been investigated by using the simulated soil solutions by many researchers to avoid the complex and heterogeneous soil structure by using varying quantities of acid [11–13]. Most studies on real soils are on the effect of moisture content and corresponding corrosion of buried pipes in laboratories [8–10].

The other notable chemical constitute of the soil, i.e., chloride, well known for its corrosion-causing capability particularly to reinforce concrete structures [14] can be responsible to the failure of steel pipes. However, from the comprehensive reviews, it can be found out that the research related to the effect of chlorides present in soil and the corresponding corrosion of carbon steel pipes is limited. Considering this gap, current research is conducted in which varying quantity of moisture and chlorides contents of the soil are taken into consideration for finding their effect and a coupled threshold value which would be useful to determine the service life of buried pipes.

## 2. Experimental methodology

The microstructure of corroded carbon steel samples exposed to different moisture and chloride conditions of soils was investigated. Authors conducted an experimental study on corrosion behaviour of carbon steel and zinc-electroplated and copper-electroplated carbon steels. Carbon steel specimens were exposed to 20, 40, 60, and 80 wt.% moisture, respectively, and the chloride concentration was kept at 0, 5, and 10 wt.%. First, the coupled effect of moisture and chloride which induced the maximum corrosion rate was evaluated. Then, zinc-electroplated and copper-electroplated steel specimens were exposed under similar aggressive coupled moisture and chloride condition. The details of the soils and specimen preparations and the chemical composition of the steel and soil used can be found elsewhere [15].

Experiments were performed under laboratory-controlled temperature of  $27 \pm 1^\circ\text{C}$ . The set-up for the electrochemical measurements consisted of three electrode cells. The schematic diagram of the experimental test set-up is shown in **Figure 2**. In this figure, the specimen is represented by rectangular shape; was a carbon steel without coating, and with zinc- and copper-electroplated coatings, respectively; and was used as working electrode. In addition, two counter electrodes made of graphite and joined through electrical connector and copper/copper sulphate ( $\text{Cu}/\text{CuSO}_4$ ) solution as reference electrode (RE) were used, respectively, for corrosion measurement of each specimen used in the current research. The surface area ratio between working electrode/counter electrode was kept at 0.909.

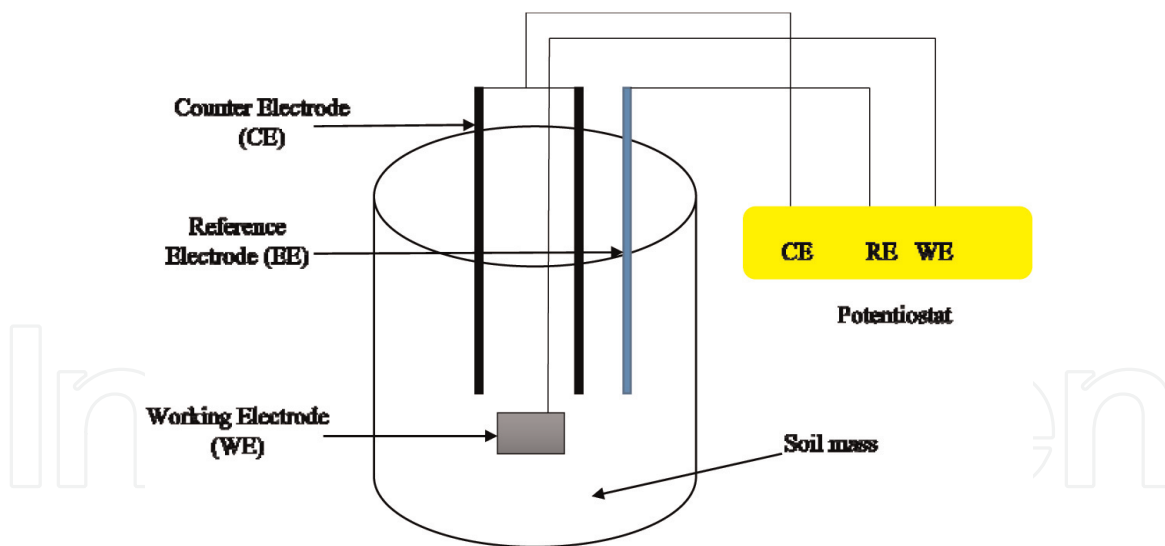

**Figure 2.**  
 Set-up for electrochemical measurement (modified after Shoaib et al. [15]).

Electrochemical measurements, i.e., electrochemical impedance spectroscopy (EIS), were performed using Autolab PGSTAT302N potentiostat/galvanostat. Before performing electrochemical measurement, metallic samples were cleaned as per ASTM G1-03. Then each specimen was buried into 1000 g of soil containing controlled moisture contents, chloride concentrations, and combination of both as discussed earlier. The open circuit potential of working electrode was observed for 3600 s. More details of the EIS and potentiodynamic polarisation procedures executed in the current research can be found in author's recent publication [15]. The EIS data was fit by using Nova 1.1.1 software for corrosion analysis. After knowing the corrosion rates of specimens, deep microstructure analysis of the corrosion morphology of all the specimens was executed using scanning electron microscopy (SEM). The corrosion results obtained and the related discussion are presented in the following section. More details about the preparation of specimens and soils can be found elsewhere [15].


### 3. Results and discussion

#### 3.1 Electrochemical study on SS400 carbon steel

The electrochemical study is carried out to investigate the corrosion behaviour of metals. Shoaib et al. [15] examined the influence of moisture and chloride on the corrosion behaviour of SS400 carbon steel in the soil environment.

Electrochemical results showed that the corrosion rate of SS400 carbon steel sample increased with increase in moisture content up to 60 wt.% and decreased after this value. Moreover, with the addition of chloride, corrosion rate increased appreciably. The maximum corrosion rate was noticed for carbon steel exposed to soil containing 60 wt.% moisture and 5 wt.% moisture. Theoretically, carbon steel specimen buried in 60 wt.% moisture and 10 wt.% chloride should have more corrosion rate because of exposure of higher chloride content. Probably, the possible reason could be a non-homogeneous nature of the soil, or there is a possibility that organic contents might have caused the increase in soil's resistivity and hence the decrease in corrosion rate even in the presence of higher chlorides.

The corrosion rates of carbon steel samples under different exposure conditions are shown in **Figure 3**. The detailed discussion on the corrosion behaviour of various specimens can be found elsewhere [15]. After electrochemical

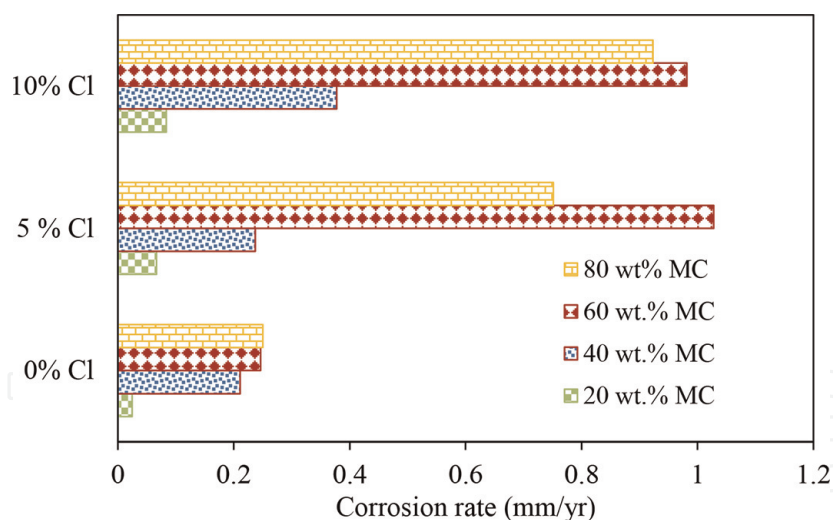

**Figure 3.** Corrosion rates of SS400 steel samples under different moisture and chloride conditions (modified after Shoaib et al. [15]).

measurements of various steel samples, they were examined using laser microscope, scanning electron microscope (SEM), and energy-dispersive X-ray spectroscopy (EDS) to investigate the influence of chemicals in soils on the microstructure of buried steel samples. The discussion is presented in the following section.


### 3.2 Microscopic observation

First, the coupled effects of varying moisture and chloride on corrosion were measured [15]; then their subsequent impact on the microstructure of specimens was investigated using Olympus laser microscope. Corrosion patterns on specimens after exposure to various corrosive soils are shown in **Figures 4–6**; from these figures red rust can be seen on all samples. Interestingly, there was a further addition of red rust with the increase of chloride contents indicating the presence of iron oxides on the surface. Moreover, optical images also confirmed that the addition of chloride promoted corrosion progress. With further addition of chloride, more red rust was observed.


Two kinds of corrosion behaviour were observed in specimens, i.e., general and localised corrosion. Carbon steel sample exposed to soil containing 60 wt.% moisture and 5 wt.% chloride showed localised corrosion, while the samples buried in soil of 80 wt.% moisture and 10 wt.% chloride suffered general corrosion. **Figure 7** shows the corrosion morphology of copper-electroplated and zinc-electroplated steel samples. However, for copper-electroplated steel samples, there was no clear pattern of corrosion. On the other hand, zinc-electroplated steel indicated localised corrosion.

### 3.3 Corrosion product morphology


SEM analyses were performed after the samples were corroded to various soil conditions. **Figure 8** shows the SEM micrographs of low and high magnifications of carbon steel. From this figure, a porous and honeycomb-like structure appeared, which is also reported by earlier researchers [16]. **Figure 9** shows EDS spectra of elements present in corrosion product of carbon steel, while the elements in the corrosion layer of carbon steel are shown in **Table 1**. The presence of sodium (Na) on a metallic surface, indicating that cation in soil penetrated through corrosion product layer and reached the sample's surface. As a result of this penetration, the corrosion process is accelerated. However, it has been reported in literature that the

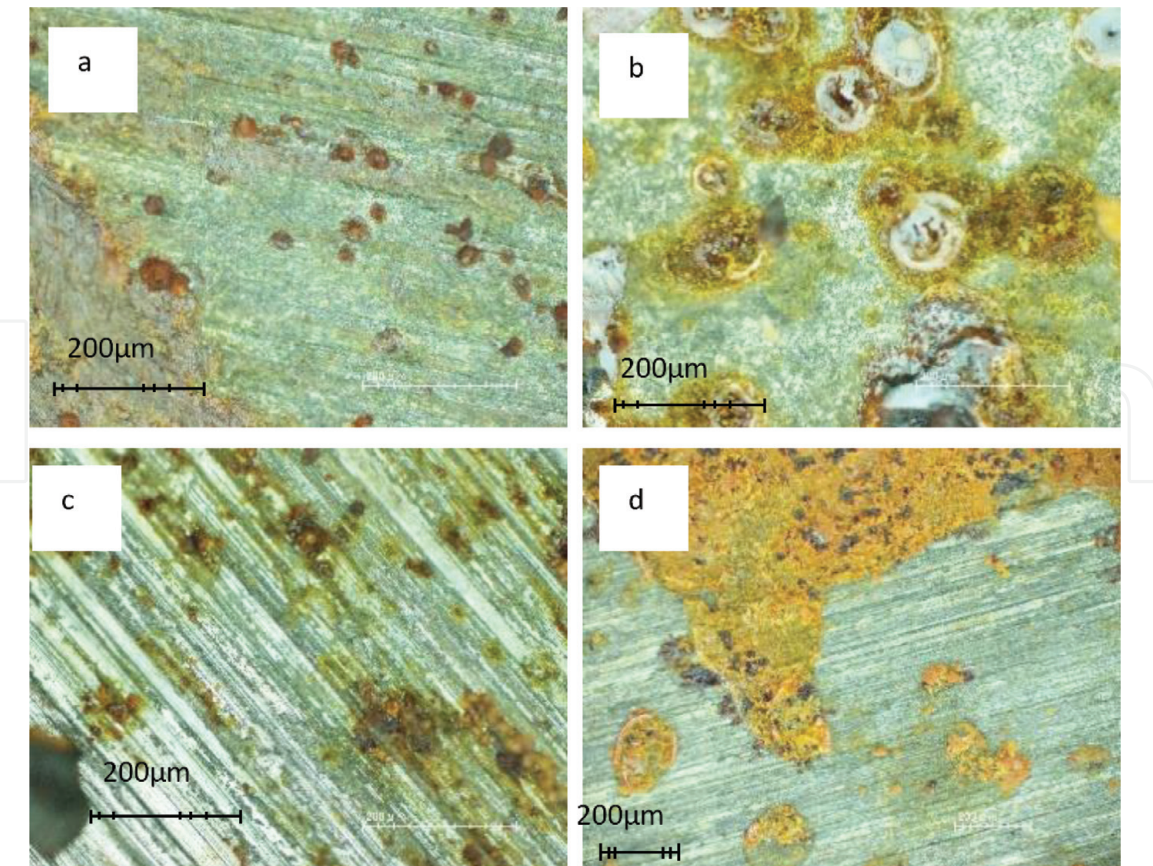

**Figure 4.**  
*Corrosion morphology of carbon steels tested in different soil moisture contents (a = 20 wt.% MC; b = 40 wt.% MC; c = 60 wt.% MC; d = 80 wt.% MC).*

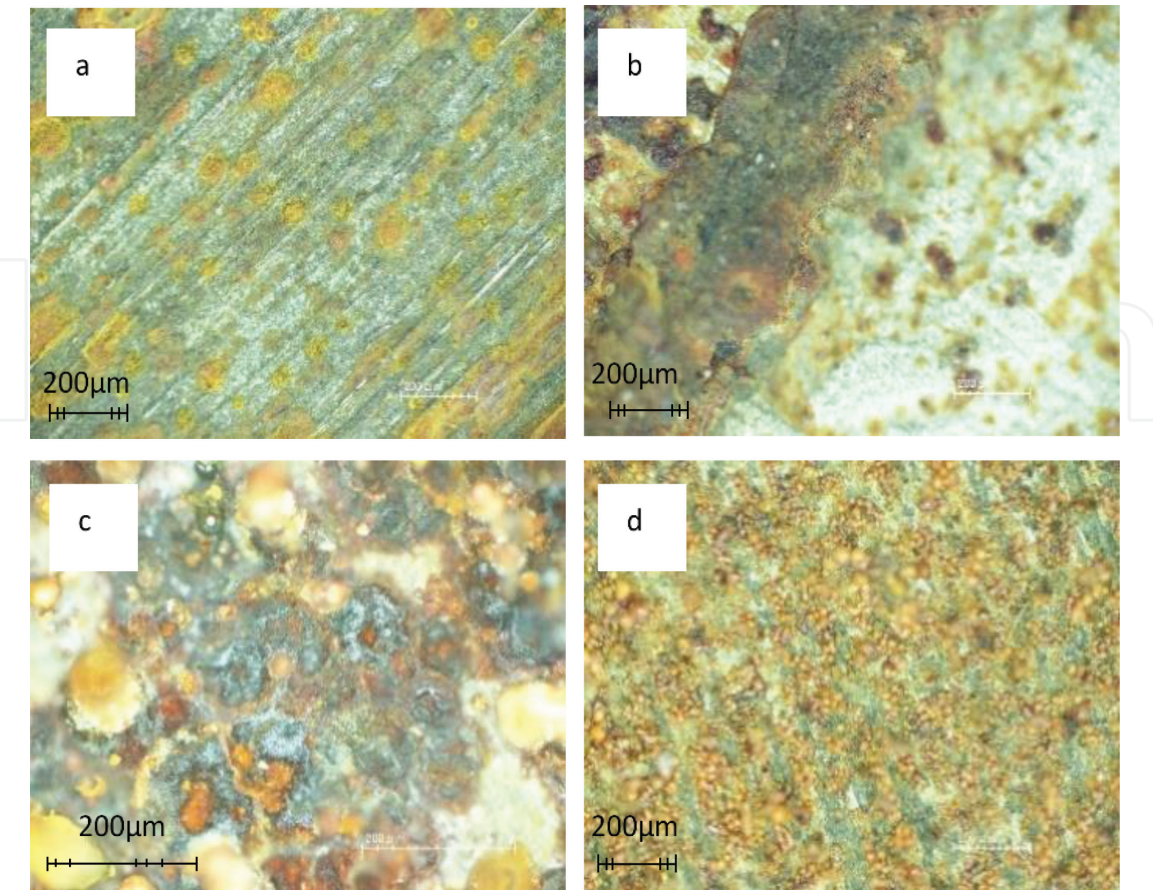


**Figure 5.**  
*Corrosion morphology of carbon steels tested in soil with 5 wt.% chloride (a = 20 wt.% MC; b = 40 wt.% MC; c = 60 wt.% MC; d = 80 wt.% MC).*

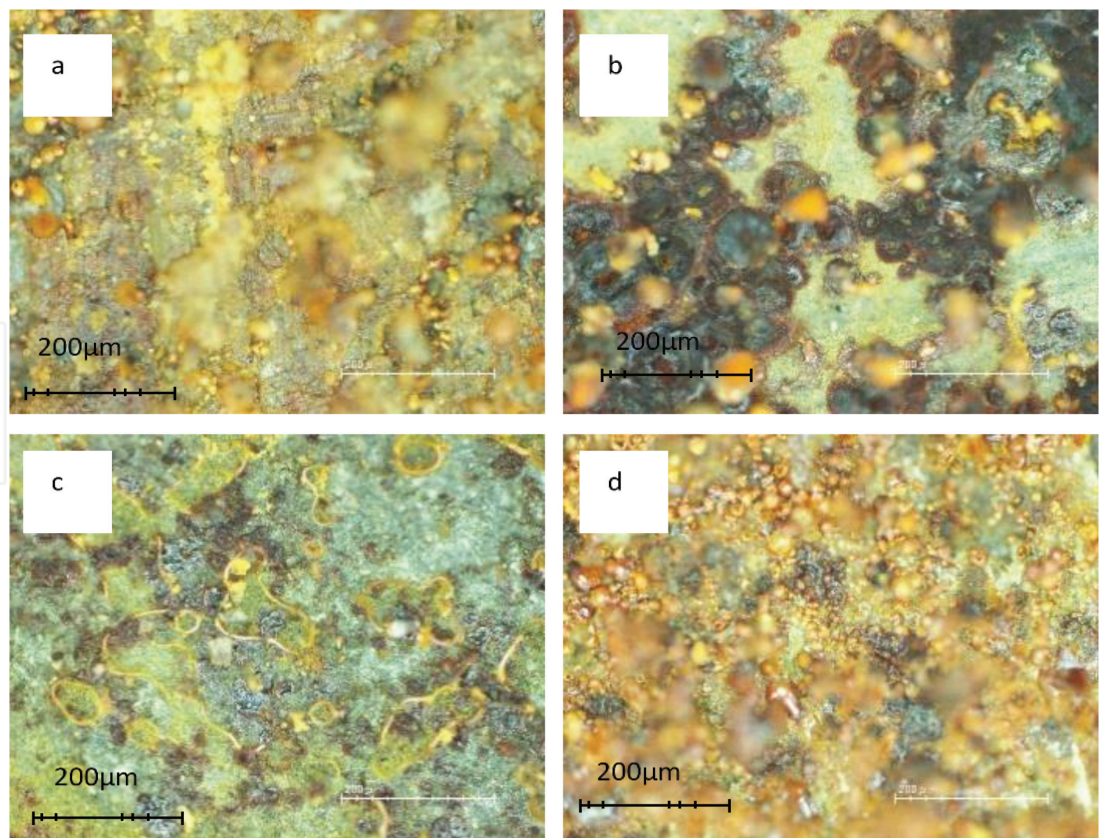


**Figure 6.**  
*Corrosion morphology of carbon steels tested in soil with 10 wt.% chloride (a = 20 wt.% MC; b = 40 wt.% MC; c = 60 wt.% MC; d = 80 wt.% MC).*

initial corrosion product formed on carbon steel is  $\alpha$ -FeOOH which provides a shield to substrate metal against corrosion [17, 18].

**Figure 10** SEM images of zinc-electroplated steel with a low and high magnification. A crystalline structure was observed which spread over the surface area of the sample. This indicates the occurrence of generalised corrosion mechanism [19]. The EDS spectra of elements present in corrosion product of zinc-electroplated steel are shown in **Figure 11**. Three locations were selected for the determination of elements in corrosion product. Elements obtained from the corroded layer of zinc-coated steel are shown in **Table 2**. Elements determined were Zn, Fe, O, and Cl

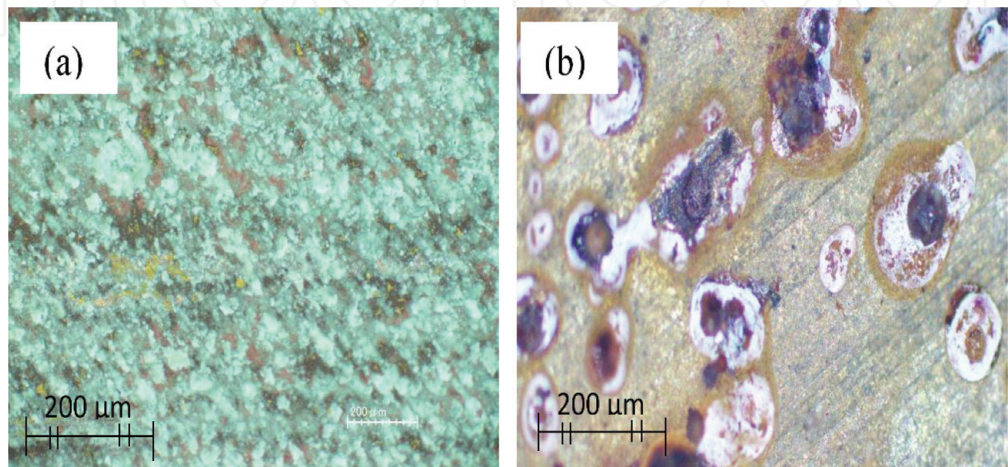


**Figure 7.**  
*Corrosion morphology of (a) copper-electroplated and (b) zinc-electroplated steels tested in soil with 60 wt.% moisture and 5 wt.% chloride.*

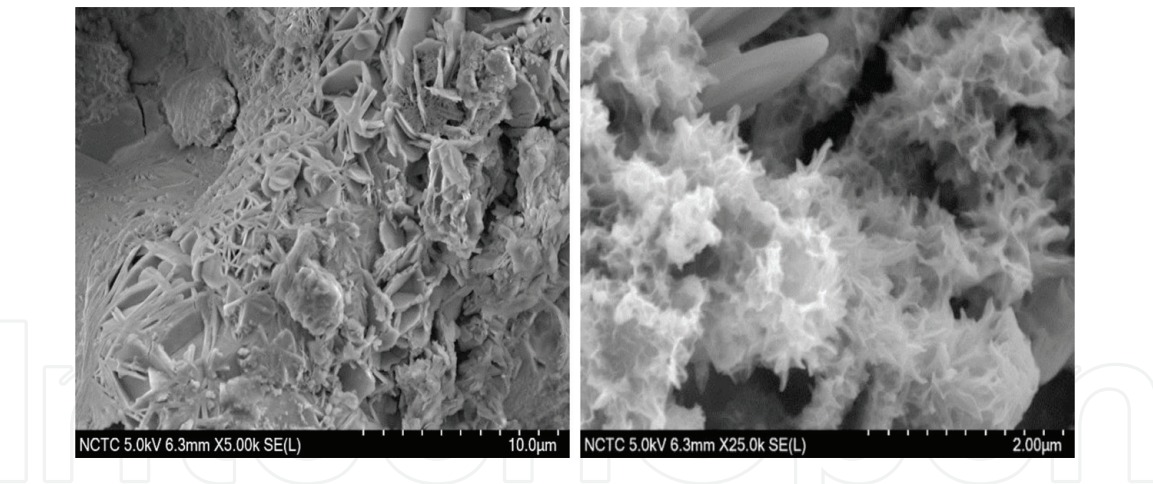

**Figure 8.**  
*SEM images of carbon steel buried in soil of 60 wt.% moisture and 5 wt.% chloride.*

which indicated the likelihood of zinc oxide (ZnO) is formed. Zinc oxide provides a protective layer and protects the substrate metal from further corrosion [20]. However, the presence of Fe indicates that protective layer of zinc was removed partially due to soil aggressiveness.


**Figure 12** shows SEM micrographs of copper-coated steel with a low and high magnification. From this figure corrosion pattern of granular and compact structure can be seen which is also reported in the literature [21]. However, **Figure 13** demonstrates EDS spectra of elements present in corrosion product of copper-coated steel, also listed in **Table 3**. From the table it can be seen that Br was present in trace

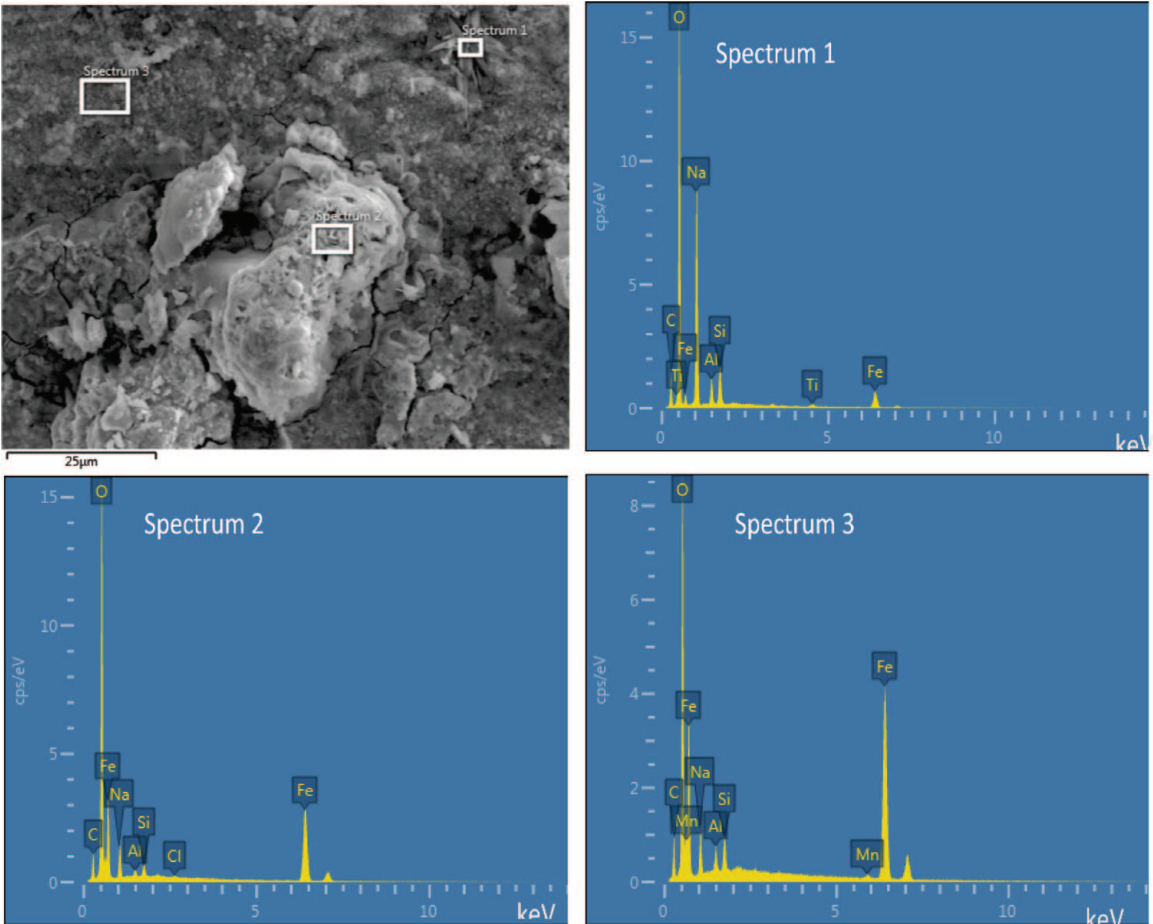


**Figure 9.**  
*EDS spectra of carbon steel tested in soil with 60 wt.% moisture and 5 wt.% chloride.*

Element	Spectrum 1	Spectrum 2	Spectrum 3
Fe	9.5	40.1	56.6
O	51	43.7	26.5
Na	20.4	4.1	3.6
C	13.7	10.6	10.1
Si	2.8	0.8	1.4
Al	2	0.6	1
Mn	—	—	0.8
Cl	—	0.2	—
Ti	0.6	—	—

**Table 1.**  
EDS analyses (wt.%) of carbon steel of selected spots in **Figure 8**.

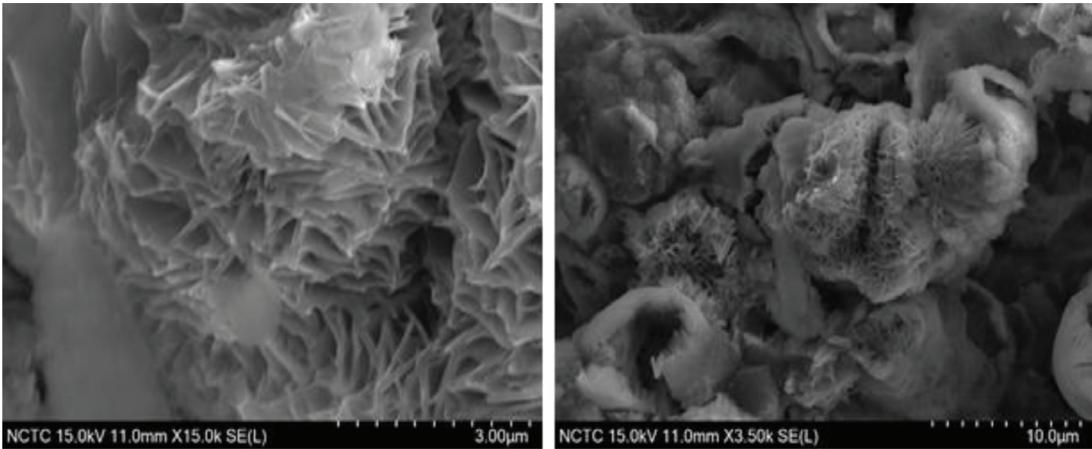


**Figure 10.**  
SEM images of zinc-coated steel tested in soil with 60 wt.% moisture and 5 wt.% chloride.

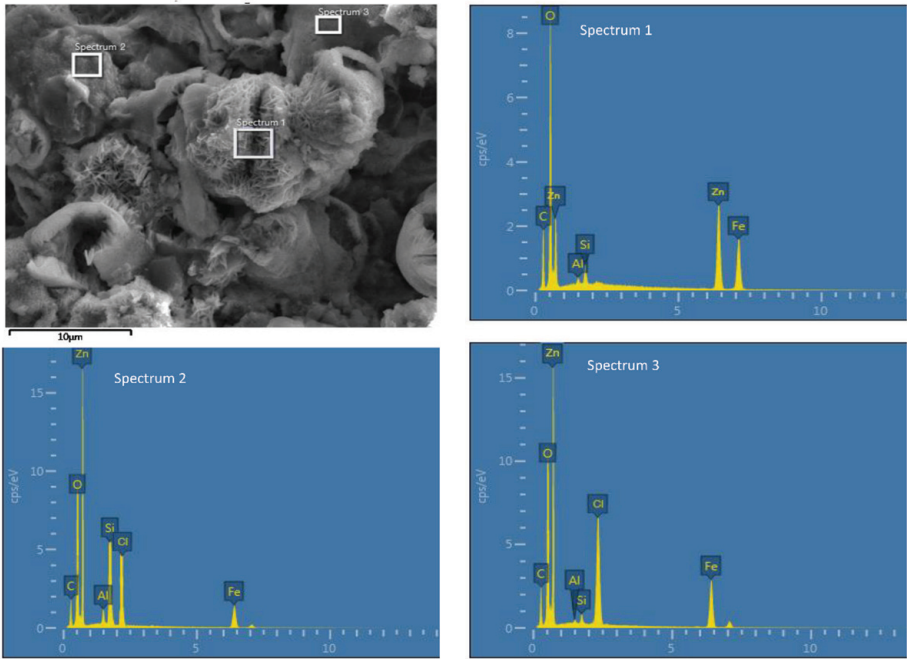


**Figure 11.**  
EDS spectra of zinc-coated steel tested in soil with 60 wt.% moisture and 5 wt.% chloride.

Element	Spectrum 1	Spectrum 2	Spectrum 3
Zn	43.4	31.2	26.2
O	22.4	17.6	30.7
Fe	12.1	12.7	9.3
C	20.4	13.8	12.6
Si	1.2	8.6	4.2
Al	0.5	0.9	0.3
Cl	—	15.2	16.7

**Table 2.**  
EDS analyses (wt.%) of zinc-coated steel for selected spots in **Figure 9**.

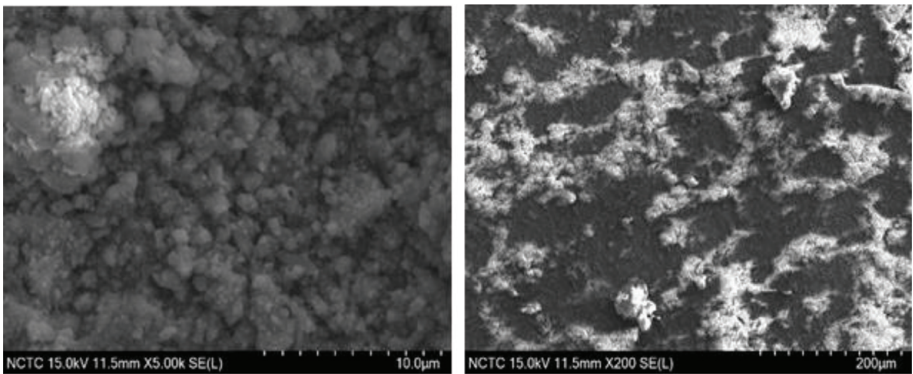

**Figure 12.**  
SEM images of copper-coated steel tested in soil with 60 wt.% moisture and 5 wt.% chloride.

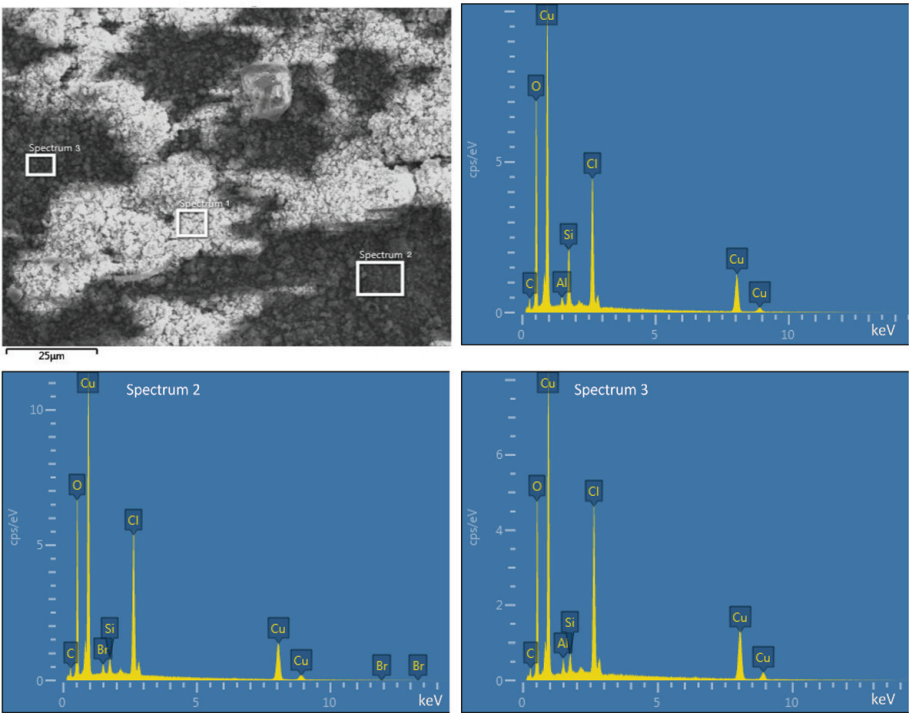

**Figure 13.**  
EDS spectra of copper-coated steel tested in soil with 60 wt.% moisture and 5 wt.% chloride.

amount in substrate metal. Br contributes to the acceleration of corrosion, but it is less aggressive than Cl. From the analysis results, it is evident that there is less quantity of Br (1.6%) in corrosion product of copper-coated steel which means Br did

Element	Spectrum 1	Spectrum 2	Spectrum 3
Cu	45.2	47.2	46.3
O	29.8	27.5	27.3
Cl	11.7	13.5	15.3
C	8.7	9	8.7
Si	4	1.6	1.4
Al	0.6	1.1	1.1

**Table 3.**  
EDS analyses (wt.%) of copper-coated steel for selected spots in **Figure 12**.

not contribute to corrosion significantly. The elements present in the corrosion product show the possibility of the presence of copper chloride and copper oxide [21, 22].

The presence of Cl element in the corrosion layer of carbon, zinc-coated, and copper-coated steels was obviously due to the addition of NaCl. The Cl anion is classified as aggressive because it directly contributes in electrochemical reaction causing corrosion. Cl anion present in coated samples reveals that it has a strong tendency to promote corrosion rate even if the metallic surface is coated with zinc or copper.


3.4 Energy-dispersive X-ray spectroscopy (EDS) mapping

Cross-sectional EDS map of specimens buried in soil containing 80 wt.% moisture is shown in **Figure 14a** and **b**. In **Figure 14a**, O-K and Fe-K element maps show that oxygen and iron are uniformly distributed. The co-existence of O and Fe elements demonstrates that oxides of iron are present in corrosion products. Generally,  $\alpha$ -FeOOH and  $\gamma$ -FeOOH are observed as corrosion products of steel buried in the soil environment. A C-K element from epoxy resin has a non-uniform distribution. At site 2 (**Figure 14b**), there is an excessive concentration of C-K due to the epoxy resin, and there is less concentration of O-K and O-K at this site.


**Figure 15a** and **b** demonstrates cross-sectional EDS map of carbon steel sample exposed to soil containing 60 wt.% moisture and 5 wt.% chloride at site 1. A pit can be observed on carbon steel sample. It confirms that exposure of carbon steel to soil containing chloride accelerates the corrosion; as a result pitting is observed. The layer of oxygen has a variable thickness, and C layer from epoxy has a non-uniform thickness due to which no chloride contents were observed. The possible reason is that any element having a concentration less than 1% cannot be mapped by EDS mapping technique because peaks of elements having less concentration are difficult to separate from the background. **Figure 15b** shows EDS mapping at site 2, where the pit is less wide than site 1.

**Figure 16a** and **b** illustrates the EDS mapping of steel specimens buried in soil containing 60 wt.% moisture and 10 wt.% chloride. This specimen showed entirely different behaviour as there was less O-K concentration, which also confirms the SEM results of no stable oxide layer, while the concentration of Fe-K came out to be high. It can be interpreted from mapping results that there are fewer oxides present in this condition.

Theoretically, carbon steel specimens exposed to 10 wt.% chloride should be more corroded than 5 wt.% chloride; however, experimentally this was not observed. The reason for this phenomenon is probably due to the fact that soil is a non-homogeneous, and its properties vary within the soil itself. There is a possibility that soil sample used for 60 and 5 wt.% chloride conditions might have considerable chloride already present in it. Furthermore, it is also possible that the soil sample used

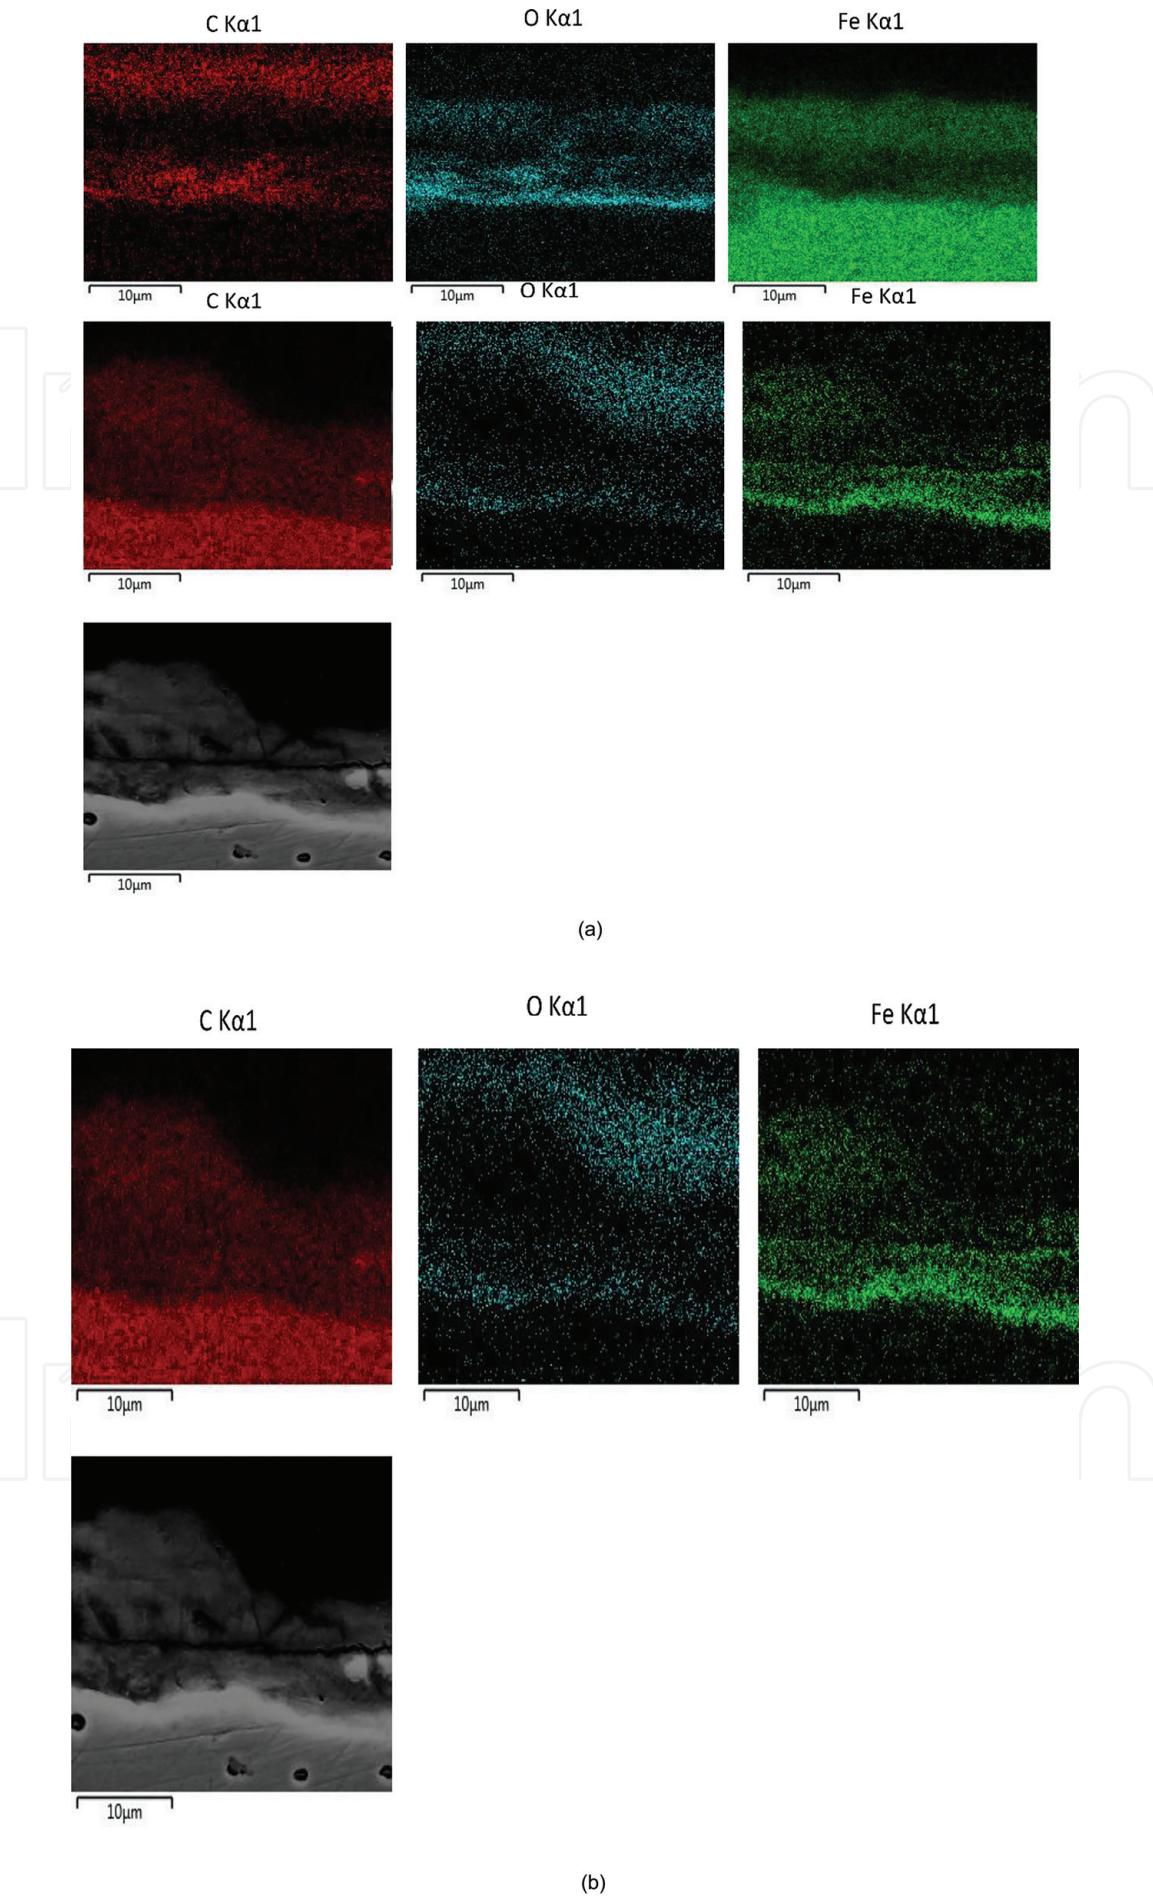


**Figure 14.**  
(a) EDS map of carbon steel exposed to soil containing 80 wt.% moisture (site 1). (b) EDS map of carbon steel exposed to soil containing 80 wt.% moisture (site 2).

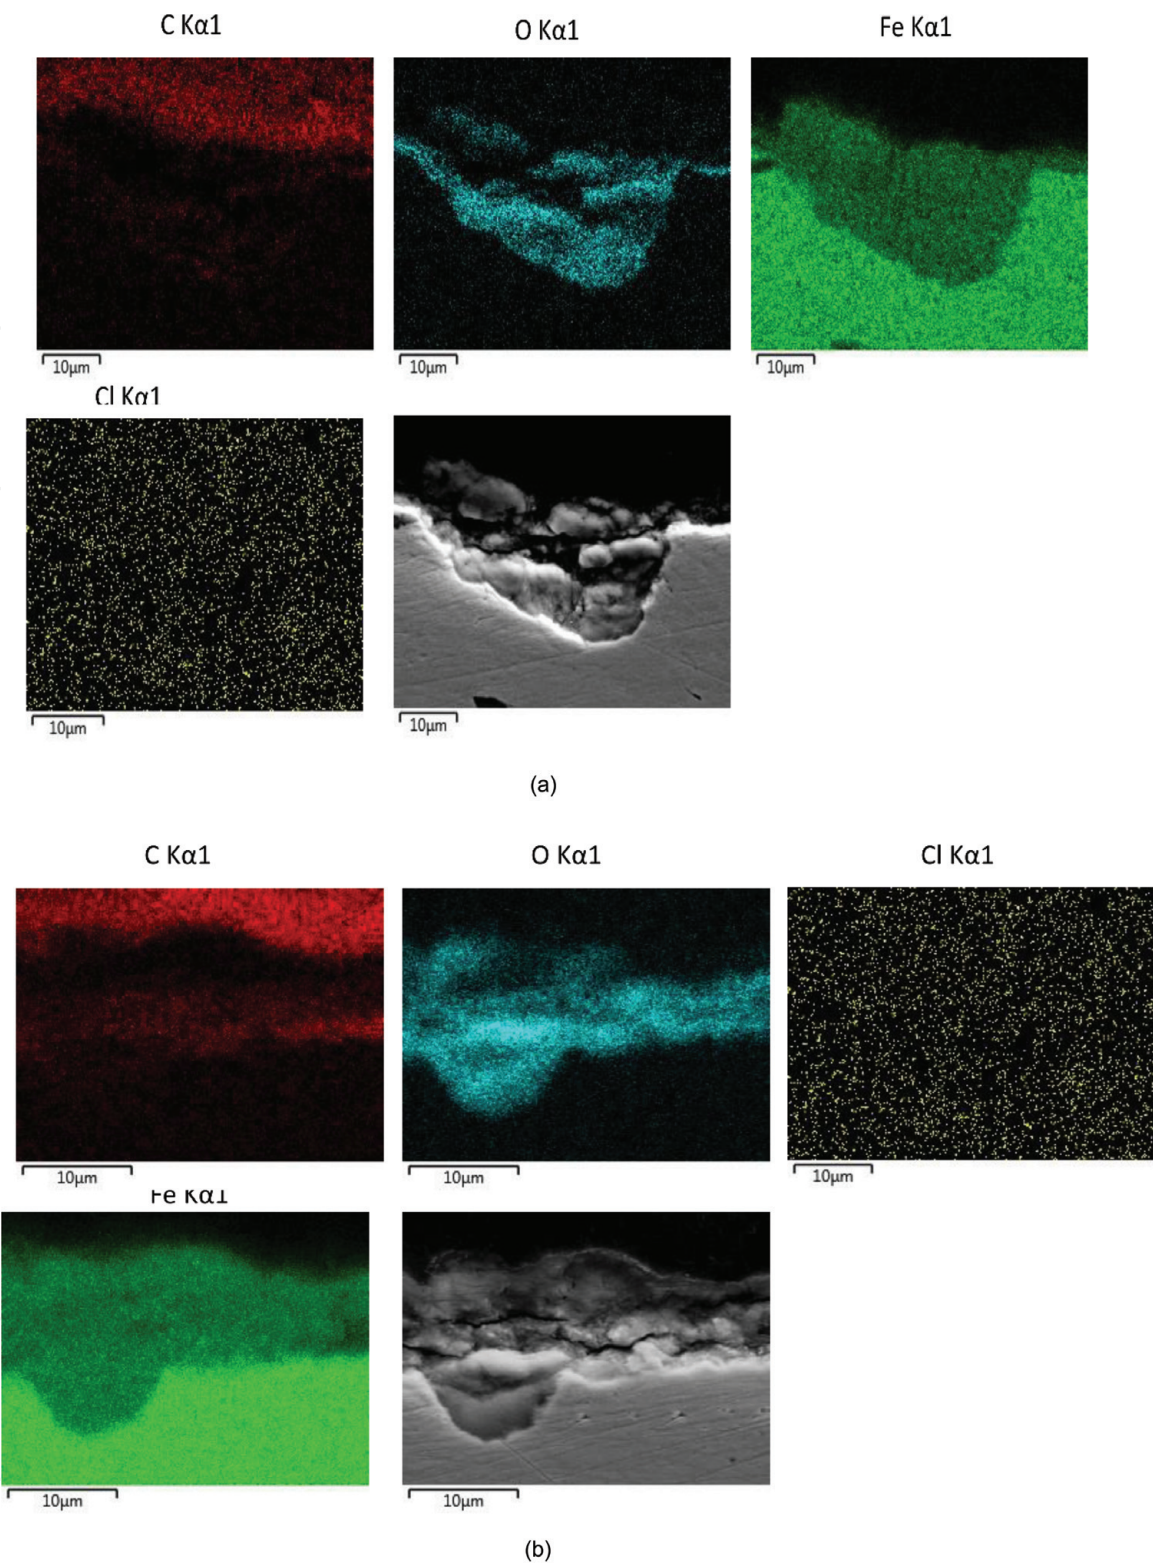

**Figure 15.**  
(a) EDS map of carbon steel exposed to soil containing 60 wt.% moisture and 5 wt.% chloride (site 1). (b) EDS map of carbon steel buried in soil containing 60 wt.% moisture and 5 wt.% chloride (site 2).

for 60 and 10 wt.% might have organic contents. The presence of organic contents in soil increases the soil resistivity and ultimately decreases the corrosion rate. It is concluded from the above discussion that the addition of chloride in soil accelerates the corrosion rate significantly and in a short time. The increase in exposure duration to chloride-contaminated soil can lead to pitting of carbon steel.

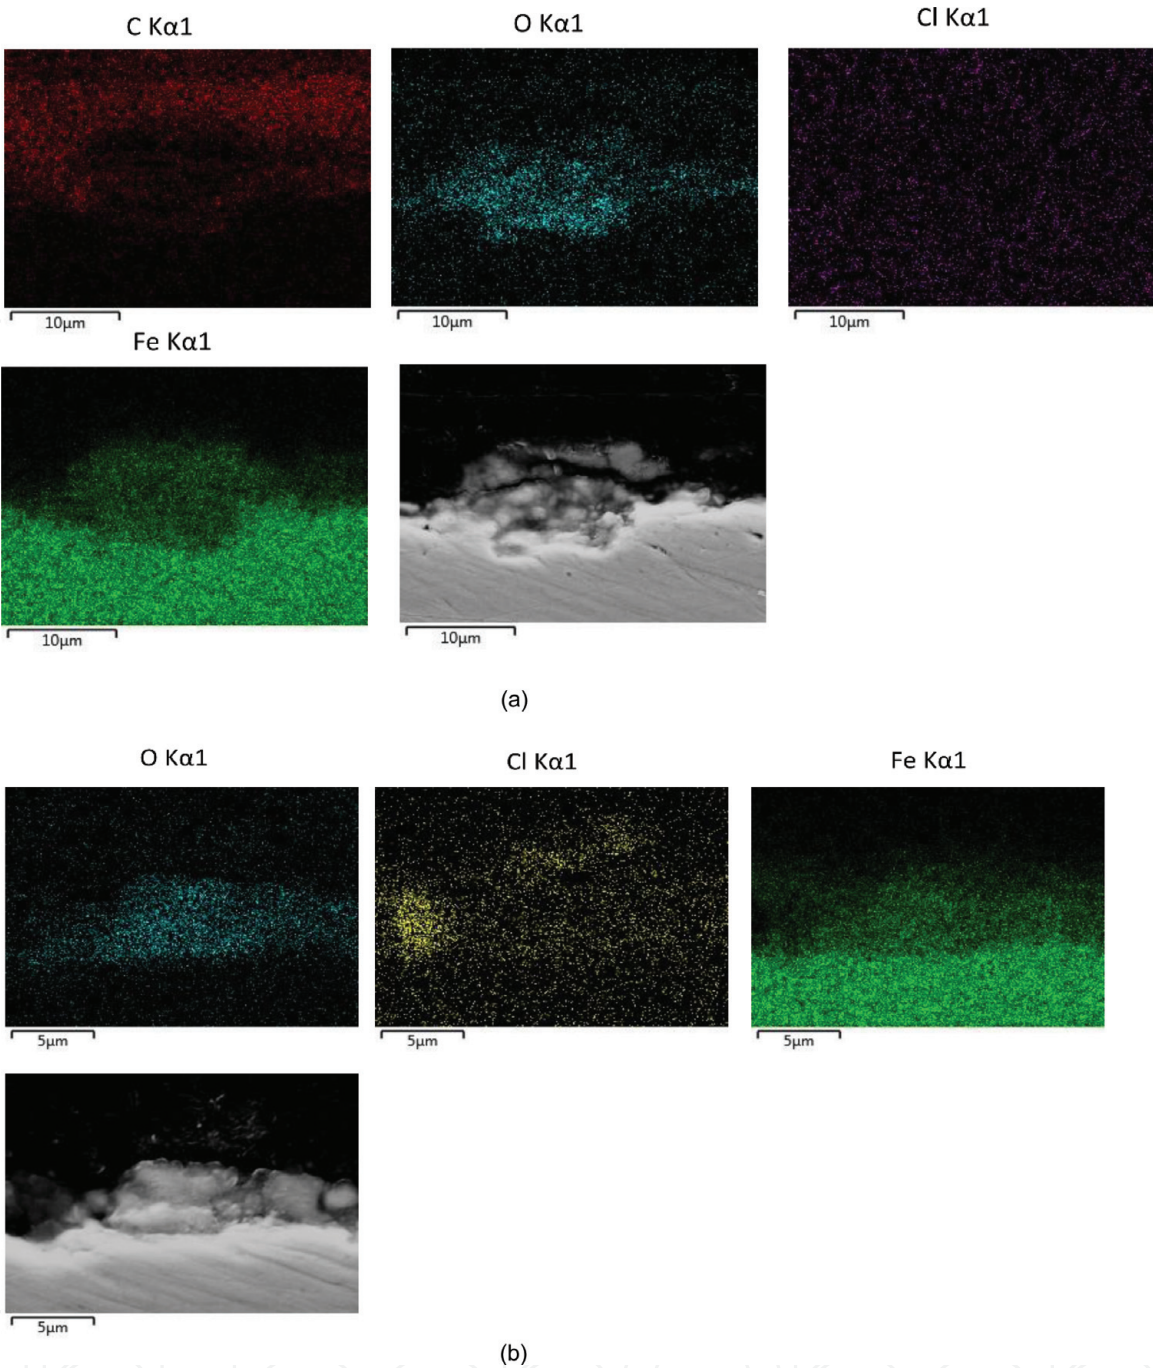

**Figure 16.**  
(a) EDS map of carbon steel exposed to soil containing 60 wt.% moisture and 10 wt.% chloride (site 1).  
(b) EDS map of carbon steel exposed to soil containing 60 wt.% moisture and 10 wt.% chloride (site 2).

#### 4. Conclusions

In this chapter, a study related to the influence of soil's varying moisture and chloride contents on the corrosion and subsequent microstructure of coated and uncoated carbon steel pipes is presented. From the experimental findings of corrosion and then after carrying out microstructural analysis, a threshold value for moisture and chloride contents is determined beyond which no further addition of chloride and moisture contents can cause corrosion and deterioration of microstructure of carbon steel. The results presented in this paper have practical application for the protection of coated and uncoated carbon steel pipes in soils. This study

can help owners of the steel pipes to decide which type of coating to be used for the protection of the carbon steel pipes in aggressive soil conditions such as those presented in this paper. The current research is further extended for longer exposures and evaluating the influence of corrosion on the mechanical properties of buried steel pipes.

### **Author details**

Muhammad Wasim<sup>1\*</sup> and Shahrukh Shoaib<sup>2</sup>

1 RMIT University, Melbourne University, Melbourne, Australia

2 United Arab Emirates University, Al Ain, United Arab Emirates

\*Address all correspondence to: wasim\_oct@hotmail.com

### **IntechOpen**

© 2019 The Author(s). Licensee IntechOpen. This chapter is distributed under the terms of the Creative Commons Attribution License (<http://creativecommons.org/licenses/by/3.0>), which permits unrestricted use, distribution, and reproduction in any medium, provided the original work is properly cited. 

## References

- [1] Romanoff. Underground Corrosion. Superintendent of Documents Washington, D.C. National Bureau of Standards Circular; 1957:579
- [2] Kleiner Y, Rajani B. Comprehensive review of structural deterioration of water mains: Statistical models. Urban Water. 2001;3:131-150. DOI: 10.1016/S1462-0758(01)00033-4
- [3] Romer AE, Bell GE. Causes of external corrosion on buried water mains. In: Pipelines: Advances in Pipelines Engineering & Construction; 2001. pp. 1-9. DOI: 10.1061/40574 (2001)20
- [4] Alamilla JL, Espinosa-Medina MA, Sosa E. Modelling steel corrosion damage in soil environment. Corrosion Science. 2009;51:2628-2638. DOI: 10.1016/j.corsci.2009.06.052
- [5] Cole I, Marney D. The science of pipe corrosion: A review of the literature on the corrosion of ferrous metals in soils. Corrosion Science. 2012;56:5-16. DOI: 10.1016/j.corsci.2011.12.001
- [6] Asadi ZS, Melchers RE. Long-term external pitting and corrosion of buried cast iron water pipes. Corrosion Engineering, Science and Technology. 17 Feb 2018;53(2):93-101
- [7] Wasim M, Shoaib S, Mubarak NM, Asiri AM. Factors influencing corrosion of metal pipes in soils. Environmental Chemistry Letters. 2018;1:1-9
- [8] Qin F, Jiang C, Cui X, Wang Q, Wang J, Huang R, et al. Effect of soil moisture content on corrosion behavior of X70 steel. International Journal of Electrochemical Science. 2018;13: 1603-1613. DOI: 10.20964/2018.02.32
- [9] Gupta S, Gupta B. The critical soil moisture content in the underground corrosion of mild steel. Corrosion Science. 1979;19:171-178. DOI: 10.1016/0010-938X(79)90015-5
- [10] Wan Y, Ding L, Wang X, LI Y, Sun H, Wang Q. Corrosion behaviors of Q235 steel in indoor soil. International Journal of Electrochemical Science. 2013;8:12531-12542
- [11] Noor EA, Al-Moubaraki AH. Influence of soil moisture content on the corrosion behavior of X60 steel in different soils. Arabian Journal for Science and Engineering. 1 Jul 2014; 39(7):5421-5435
- [12] Liu ZY, Li XG, Du CW, Lu L, Zhang YR, Cheng YF. Effect of inclusions on initiation of stress corrosion cracks in X70 pipeline steel in an acidic soil environment. Corrosion Science. 2009;51:895-900
- [13] Yang Y, Cheng F. Effect of stress on corrosion at crack tip on pipeline steel in a near-neutral pH solution. Journal of Materials Engineering and Performance. 2016;25:4988-4995. DOI: 10.1007/s11665-016-2369-9
- [14] Zhou Y, Gencturk B, Willam K, Attar A. Carbonation-induced and chloride-induced corrosion in reinforced concrete structures. Journal of Materials in Civil Engineering. 2014; 27(9):04014245
- [15] Shoaib S, Srinophakun TR, Palsson NS. Influence of soil conditions on corrosion behavior of buried coated and uncoated carbon steels. In: IEEE International Conference on Innovative Research and Development (ICIRD); 11-12 May 2018. DOI: 10.1109/ICIRD.2018.8376310

[16] Song Y, Jiang G, Chen Y, Zhao P, Tian Y. Effects of chloride ions on corrosion of ductile iron and carbon steel in soil environments. *Scientific Reports*. 2017;**7**:1-13. DOI: 10.1038/s41598-017-07245-1

[17] Nie X, Li X, Du C, Huang Y, Du H. Characterization of corrosion products formed on the surface of carbon steel by Raman spectroscopy. *Journal of Raman Spectroscopy*. 2009b;**40**:76-79. DOI: 10.1002/jrs.2082

[18] Kwon S, Shinoda K, Suzuki S, Waseda Y. Influence of silicon on local structure and morphology of  $\gamma$ -FeOOH and  $\alpha$ -FeOOH particles. *Corrosion Science*. 2007;**49**:1513-1526. DOI: 10.1016/j.corsci.2006.07.004

[19] Lima-Neto PD, Adriana NC, Colares PR, Walney SA. Corrosion study of electrodeposited Zn and Zn-Co coatings in chloride medium. *Journal of the Brazilian Chemical Society*. 2007;**18**: 1164-1175. DOI: 10.1590/S0103-50532007000600010

[20] Spathis P, Poulos I. The corrosion and photocorrosion of zinc and zinc coatings. *Corrosion Science*. 1995;**37**: 673-680

[21] Kamboj A, Paghupathy Y, Rekha MY, Srivastavai C. Morphology, texture and corrosion behavior of nanocrystalline copper-graphene composite coatings. *Journal of Materials*. 2017;**69**:1149-1154

[22] Afonso FS, Neto MMM, Mendonça MH, Pimenta G, Proença L, Fonseca ITE. Copper corrosion in soil: Influence of chloride contents, aeration and humidity. *Journal of Solid State Electrochemistry*. 2009;**13**:1757-1765. DOI: 10.1007/s10008-009-0868-4